

2012 - Mazda6 - Engine

NO.25 A/ C IS NOT CUT OFF UNDER WIDE OPEN THROTTLE CONDITIONS [MZR 2.5]

25	A/C IS NOT CUT OFF UNDER WOT CONDITIONS
DESCRIPTION	A/C compressor magnetic clutch does not disengage under WOT.
POSSIBLE CAUSE	- APP sensor malfunction - Loosely installed APP sensor

Diagnostic procedure

STEP	INSPECTION	RESULTS	ACTION
1	VERIFY A/ C SYSTEM OPERATION Does the magnetic clutch disengage when the A/C switch is turned off?	Yes	Go to the next step.
		No	Go to the symptom troubleshooting "NO.24 A/C IS ALWAYS ON OR A/C COMPRESSOR RUNS CONTINUOUSLY". (See NO.24 A/ C IS ALWAYS ON OR A/ C COMPRESSOR RUNS CONTINUOUSLY [MZR 2.5] .)
2	VERIFY PCM DTC - Retrieve any DTCs using the M-MDS. (See ON-BOARD DIAGNOSTIC TEST [MZR 2.5].) - Are there any DTCs displayed?	Yes	Go to the appropriate DTC inspection. (See DTC TABLE [MZR 2.5] .)
		No	Inspect the APP sensor. (See ACCELERATOR PEDAL POSITION (APP) SENSOR INSPECTION [MZR 2.5] .) Repair or replace the malfunctioning part according to the inspection results.
3	- Verify test results. - If normal, return to diagnostic index to service any additional symptoms. (See SYMPTOM DIAGNOSTIC INDEX [MZR 2.5].)		

- If malfunction remains, inspect related Service Bulletins and/or On-line Repair Information and perform repair or diagnosis.
 - If vehicle is repaired, troubleshooting completed.
 - If vehicle is not repaired or additional diagnostic information is not available, reprogram the PCM if a later calibration is available. Retest.

[< Previous](#) [Next >](#)

[Back to Top](#)

© 2011 Mazda North American Operations, U.S.A.

2012 - Mazda6 - Engine

NO.25 A/ C IS NOT CUT OFF UNDER WIDE OPEN THROTTLE CONDITIONS [MZR 2.5]

25	A/C IS NOT CUT OFF UNDER WOT CONDITIONS
DESCRIPTION	A/C compressor magnetic clutch does not disengage under WOT.
POSSIBLE CAUSE	- APP sensor malfunction - Loosely installed APP sensor

Diagnostic procedure

STEP	INSPECTION	RESULTS	ACTION
1	VERIFY A/ C SYSTEM OPERATION Does the magnetic clutch disengage when the A/C switch is turned off?	Yes	Go to the next step.
		No	Go to the symptom troubleshooting "NO.24 A/C IS ALWAYS ON OR A/C COMPRESSOR RUNS CONTINUOUSLY". (See NO.24 A/ C IS ALWAYS ON OR A/ C COMPRESSOR RUNS CONTINUOUSLY [MZR 2.5] .)
2	VERIFY PCM DTC - Retrieve any DTCs using the M-MDS. (See ON-BOARD DIAGNOSTIC TEST [MZR 2.5].) - Are there any DTCs displayed?	Yes	Go to the appropriate DTC inspection. (See DTC TABLE [MZR 2.5] .)
		No	Inspect the APP sensor. (See ACCELERATOR PEDAL POSITION (APP) SENSOR INSPECTION [MZR 2.5] .) Repair or replace the malfunctioning part according to the inspection results.
3	- Verify test results. - If normal, return to diagnostic index to service any additional symptoms. (See SYMPTOM DIAGNOSTIC INDEX [MZR 2.5].)		

- If malfunction remains, inspect related Service Bulletins and/or On-line Repair Information and perform repair or diagnosis.
 - If vehicle is repaired, troubleshooting completed.
 - If vehicle is not repaired or additional diagnostic information is not available, reprogram the PCM if a later calibration is available. Retest.

[< Previous](#) [Next >](#)

[Back to Top](#)

© 2011 Mazda North American Operations, U.S.A.