


2012 - Mazda6 - Engine

DRIVE BELT INSPECTION [MZR 2.5]

NOTE:

- Drive belt deflection/tension inspection is not necessary because of the use of the drive belt auto tensioner.
1. Verify that the drive belt auto tensioner indicator mark does not exceed the limit.
 - If it exceeds the limit, replace the drive belt. (See [DRIVE BELT REMOVAL/ INSTALLATION \[MZR 2.5\]](#).)

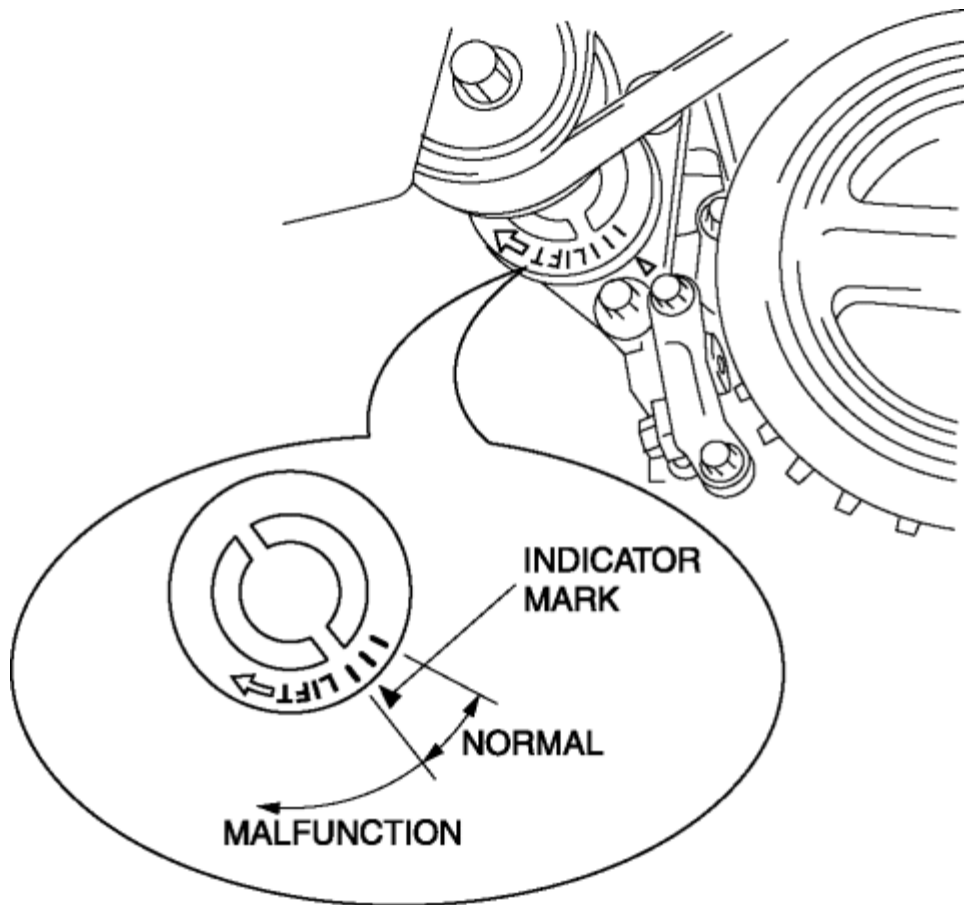

2012 - Mazda6 - Engine

DRIVE BELT INSPECTION [MZR 2.5]

NOTE:

- Drive belt deflection/tension inspection is not necessary because of the use of the drive belt auto tensioner.
1. Verify that the drive belt auto tensioner indicator mark does not exceed the limit.
 - If it exceeds the limit, replace the drive belt. (See [DRIVE BELT REMOVAL/ INSTALLATION \[MZR 2.5\].](#))

