



2012 - Mazda6 - HVAC

MAGNETIC CLUTCH ADJUSTMENT [FULL-AUTO AIR CONDITIONER]

1. Measure the clearance around the entire circumference between the pressure plate and A/C compressor pulley using a thickness gauge.

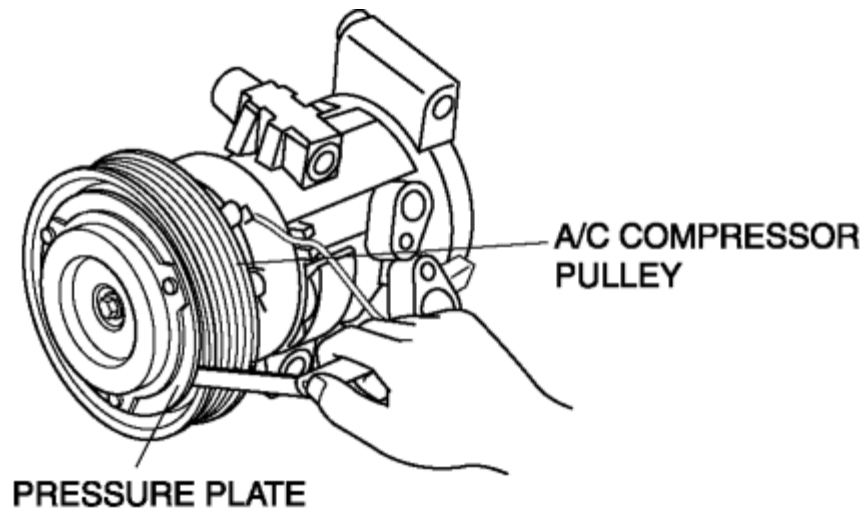

2. Verify that the clearance.

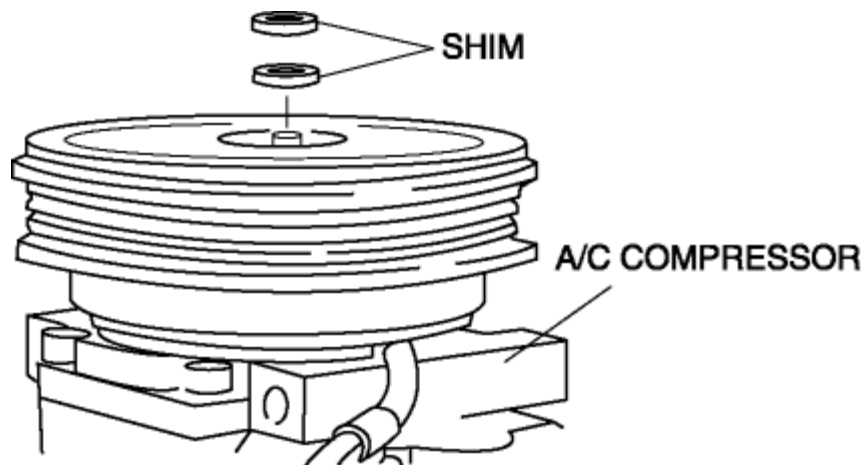

- If not within the specification, remove the pressure plate and adjust the clearance by changing the shim or the number of shims.


Magnetic clutch clearance

- 0.3—0.6 mm {0.012—0.023 in}


2012 - Mazda6 - HVAC

MAGNETIC CLUTCH ADJUSTMENT [FULL-AUTO AIR CONDITIONER]

1. Measure the clearance around the entire circumference between the pressure plate and A/C compressor pulley using a thickness gauge.

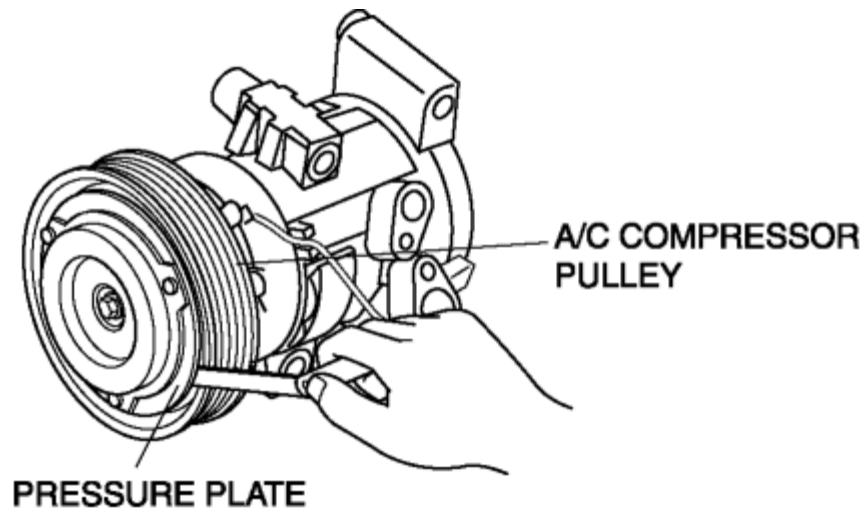

2. Verify that the clearance.

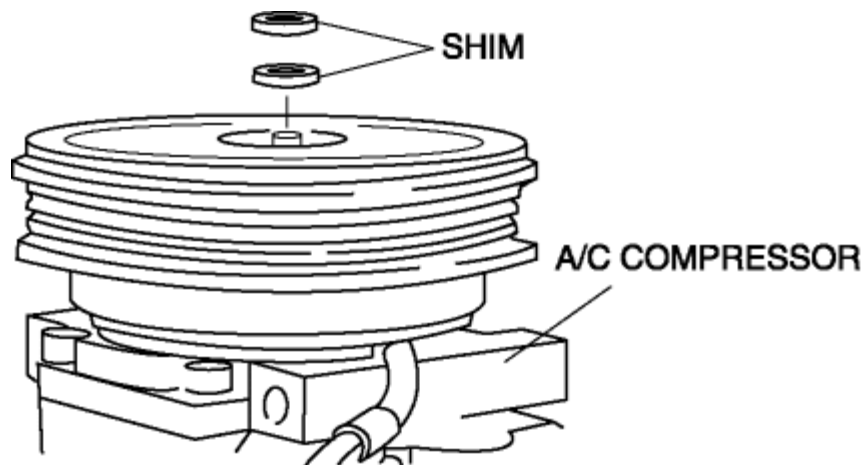

- If not within the specification, remove the pressure plate and adjust the clearance by changing the shim or the number of shims.

Magnetic clutch clearance

- 0.3—0.6 mm {0.012—0.023 in}